

# HIGH SPEED STEELS

## **Available Product Variants**

Long Products

## **Product Description**

BÖHLER S601 - "The high-speed steel"

Ideal for mills, spiral bits, and taps, broaches, cold-work tools. BÖHLER S601 is the most commonly used high-speed steel and is the starting material for our customers who deal with high-speed steel.

## **Process Melting**

Airmelted

## **Properties**

- > Toughness & Ductility: high
- > Wear Resistance : high
- > Compressive strength: high
- > Edge Stability : high
- > Grindability: high
- > Hot Hardness (red hardness) : high

## **Applications**

- > Blades for Sawing Machines
- > Powder Pressing
- > Wear parts

- > Cold Forming / Coining
- > Rolling

- > Fine Blanking, Stamping, Blanking
- > Shearing / Machine Knives

# **Technical data**

Material designation	
1.3339	SEL
HS6-5-2	EN
M2	AISI
SKH51	JIS

Standards	
4957	EN ISO
G4403	JIS

# Chemical composition (wt. %)

С	Si	Mn	Cr	Мо	٧	W
0.85	0.35	0.25	4.1	5	1.9	6.4





### **Material characteristics**

	Compressive strength	Grindability	Red hardness	Toughness	Wear resistance	Edge Stability
BÖHLER S601	***	***	***	**	**	***
BÖHLER S200	***	**	***	**	***	**
BÖHLER \$400	***	***	***	***	**	**
BÖHLER \$401	**	***	**	***	**	***
BÖHLER S404	**	***	**	***	**	**
BÖHLER S430	**	***	**	***	**	**
BÖHLER S500	***	***	****	**	***	***
BÖHLER S600	***	***	***	**	**	***
BÖHLER S607	***	***	***	**	***	***
BÖHLER S630	***	***	***	**	**	***
BÖHLER S705	***	***	****	**	**	***
BÖHLER S730	***	***	****	**	**	****

# **Delivery condition**

An	n	$\sim$	-	~
$\Delta$	111	=u	ıc	u

Hardness (HB)	max. 280
---------------	----------

## **Heat treatment**

An	_	_	_	٠	
Δn	ın	е	а	Иľ	าต

Temperature	770 to 840 °C	controlled slow cooling in turnace (10 - 20°C / n (50 - 68°F / n)) to approx. 600°C (1110°F), dir cooling.

## Stress relieving

Temperature	600 to 650 °C	Slow cooling furnace.    To relieve stresses set up by extensive machining or in tools of intricate
remperature	000 10 030 C	shape.    After through heating, hold in neutral atmosphere for 1 to 2 hours.


# Hardening and Tempering

Temperature	1,190 to 1,230 °C	Salt bath, vacuum    Preheating: 1st stage ~ 500 °C, 2nd stage ~ 850 °C, 3rd stage ~1050 °C    Austenitising: 1190 - 1230 °C, holding time after complete heating 80 seconds, maximum 150 seconds, to avoid material damage due to overheating.   Quenching: oil, warm bath (500 - 550 °C), gas
Temperature	550 to 570 °C	Slow heating to tempering temperature immediately after austenitising.    Dwell time in the furnace 1 hour per 20 mm material thickness (at least 1 hour)    Slow cooling to room temperature    3 tempering cycles recommended    Hardness see tempering chart





## **Tempering Chart**

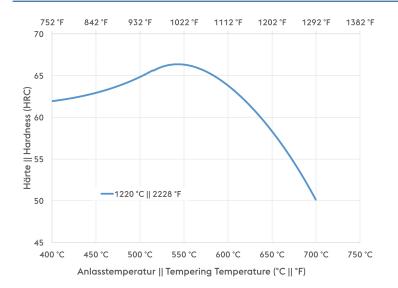

Hardening temperature: 1220°C (2228°F)

Holding time 3 x 2 hours Specimen size: square 25 mm

# **Physical Properties**

Temperature (°C)	20
Density (kg/dm³)	8.1
Thermal conductivity (W/(m.K))	19
Specific heat (kJ/kg K)	0.46
Spec. electrical resistance (Ohm.mm²/m)	0.54
Modulus of elasticity (10 <sup>3</sup> N/mm <sup>2</sup> )	217

## Thermal Expansions between 20°C | 68°F and ...

Temperature (°C)	100	200	300	400	500	600	700
Thermal expansion (10 <sup>-6</sup> m/(m.K))	11.5	11.7	12.2	12.4	12.7	13	12.9

For additional specifications and technical requirements, please contact our regional voestalpine BÖHLER sales companies.

The data contained in this brochure is merely for general information and therefore shall not be binding on the company. We may be bound only through a contract explicitly stipulating such data as binding. Measurement data are laboratory values and can deviate from practical analyses. The manufacture of our products does not involve the use of substances detrimental to health or to the ozone layer.

### voestalpine BÖHLER Edelstahl GmbH & Co KG

Mariazeller Straße 25 8605 Kapfenberg, AT T. +43/50304/20-0 E. info@bohler-edelstahl.at https://www.voestalpine.com/bohler-edelstahl/de/

